



USER MANUAL

APPLICATION NAME

MAGNETIC DESIGN TOOL

LAST APPLICATION VERSION	5.5.1.
PROGRAMMED BY	JIŘÍ VRÁŽDIL
AUTHOR OF USER MANUAL	JIŘÍ VRÁŽDIL
DATE OF ISSUE	6/13/2018
UPDATING DATE	6/13/2018

Contact:

jiri.vrazdil@epcos.com

© TDK. Reproduction, publication and dissemination of this publication, enclosures hereto and the information contained therein without EPCOS' prior express consent is prohibited

CONTENTS

1.	Introduction.....	4
1.1.	Fundamentals.....	4
1.2.	Subprograms.....	4
1.2.1.	Material Form.....	4
1.2.2.	Core Form.....	4
1.2.3.	Graph Control.....	4
1.2.4.	Starting the Program.....	5
1.2.5.	Exiting the Program.....	5
2.	Fundamentals on Operation.....	5
2.1.	Selection of the Material / Core.....	5
2.2.	Data Point Reader.....	5
2.3.	Graph Control.....	5
2.4.	Graph Output.....	5
2.5.	Input Fields.....	5
2.6.	Output Fields.....	5
3.	Material Form.....	6
3.1.	Hysteresis Loop.....	6
3.1.1.	Procedure.....	6
3.1.2.	Zoom Function.....	7
3.2.	Initial Permeability.....	7
3.2.1.	Procedure.....	7
3.2.2.	Intermediate Values of μ_i	8
3.3.	Power Loss.....	9
3.3.1.	Procedure.....	9
3.3.2.	Measured values of PL.....	10
3.3.3.	Amplitude Permeability.....	11
3.3.4.	Procedure.....	11
3.3.5.	Intermediate values of μ_a	12
3.4.	Complex Permeability.....	13
3.4.1.	Procedure.....	13
3.4.2.	Intermediate values of $\mu_s'(f)$, $\mu_s''(f)$, $\mu_p'(f)$, $\mu_p''(f)$, $g_p(f)$, $\tan\delta/\mu_i(f)$ or $Z_N(f)$	14
4.	Core Form.....	15

4.1.	Effective Permeability	15
4.1.1.	Procedure	15
4.2.	Transferable Power P_{trans}	16
4.2.1.	Procedure	16
4.2.2.	Further Description of the Input Fields	17
4.3.	Data Overview	18
4.3.1.	Procedure	18
4.4.	AL-values.....	19
4.4.1.	Procedure	19
4.5.	DC-Bias	21
4.5.1.	Procedure	21
4.5.2.	Underlying Formulae 1) :	22
4.6.	Third Harmonic Distortion	22
4.6.1.	Procedure	22
4.6.2.	Underlying Formulae:	23
4.7.	Wire Design	24
4.7.1.	Procedure	24
4.7.2.	Underlying Formulae:	25
5.	Graph Control	27
5.1.	Introduction.....	27
5.2.	Graph Layout.....	27
5.3.	Printing a graph	28
5.4.	Exporting a graph	28
5.4.1.	Exporting of graph as file	29
5.4.2.	Copying a graph via the clipboard	29
5.4.3.	Exporting data into external file.....	29
6.	Settings.....	30
7.	Reference List	31

1. Introduction

1.1. Fundamentals

The Magnetic Design Tool provides the convenient access to the material data of the available EPCOS ferrite materials and their integration in the process of design in digital form. The parameters on which the design tool is based, such as hysteresis loop, power loss, initial permeability, amplitude permeability and complex permeability are formed by the measurement data of the available EPCOS ferrite materials. These measurement data can be represented as a graph and compared to one another.

The graphs created can be printed, or pasted into other Windows applications via the clipboard. A simple editor lets you take notes relating to the selection process as you are working with the Magnetic Design Tool.

1.2. Subprograms

1.2.1. Material Form

In dependence of the material selected, this subprogram serves to graphically represent

- a hysteresis loop
- the initial permeability vs. temperature
- the power loss vs. frequency, flux density, temperature and the performance factor
- the amplitude permeability vs. flux density or field strength
- the complex permeability vs. frequency in serial and parallel representation

1.2.2. Core Form

In dependence of the material and core form selected, this subprogram serves to:

- obtain a data overview,
- calculate the AL-value in dependence of the air gap (or vice versa)
- represent the effective permeability over temperature,
- determine the transferable power P_{trans}
- calculate third harmonic distortion under circuit conditions
- calculate the appropriate air gap, Al value and the number of turns for a given permeability drop p [%] , representing the curve of inductance or permeability vs. DC-bias
- display the ratio of the AC- to DC-resistance vs. frequency.

1.2.3. Graph Control

In the Graph Control window, the representation of the graphs can be defined, the represented graphs can be printed, and they can be pasted into other Windows applications via the Clipboard.

This window can be opened from any subprogram supporting graphic representation.

1.2.4. Starting the Program

- Start the program by double-clicking on the *Ferrite Magnetics* icon in the Data Book Library program group.
- Click on the *OK* button on the introduction screen.

The program will be started with a blank editor window opened.

1.2.5. Exiting the Program

- Select the *Exit* menu item in the *File* pull-down menu. The program will be terminated.

2. Fundamentals on Operation

The basic operational procedures and the button assignments for the subprograms Material Properties and Core Calculations are identical. For this reason, they are described globally in this context.

2.1. Selection of the Material / Core

Drop-down menus for selecting the desired material and core form. Only those materials and core forms can be selected for which the desired representation (calculation) is performable.

2.2. Data Point Reader

Position the mouse pointer on a point of a measured curve on the screen and click on it with the left mouse button. The corresponding measured value will be displayed in the Data Point Reader window.

2.3. Graph Control

Clicking on these buttons calls the Graph Control window, in which the representation type of the graphs can be defined, the graphs displayed can be printed, and in which they can be made available for other Windows applications via the Clipboard. See "Graph Control" on page 26.

2.4. Graph Output

The graphs are output in this window area. By selecting multiple materials and/or core forms, graphs can be superimposed and thus conveniently compared.

2.5. Input Fields

Data for calculations can be entered in fields underlayed in white. The input is confirmed by pressing the Return key.

2.6. Output Fields

Output fields are underlayed in grey. They merely serve for displaying the results of calculations or measured values and cannot be modified.

3. Material Form

3.1. Hysteresis Loop

The program can represent the hysteresis loops at the temperatures of $T = 25\text{ °C}$ and $T = 100\text{ °C}$ for all available EPCOS ferrite materials that are included in the data book. For every point of the graph, a pair of values H , B can be displayed.

3.1.1. Procedure

- Click on the **Material Form** button in the main window. The *Material data* window will be opened.
- Select **Hysteresis**.
- Select the desired material.
- Select the desired temperature.

The hysteresis loop will be displayed.

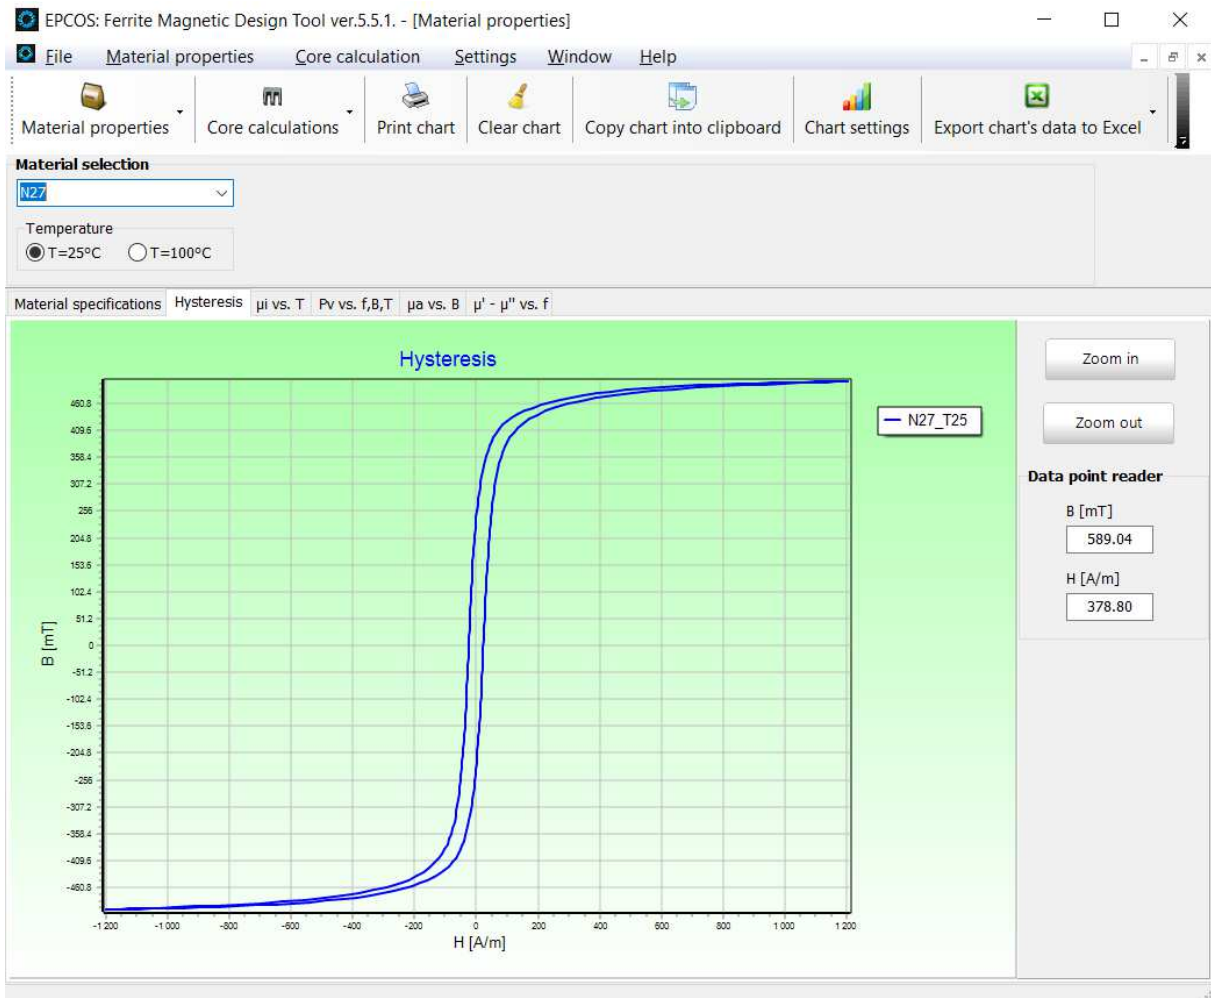


Fig. 3.1 – Hysteresis loop

Move mouse cursor on a point of the graph to view the associated pair of values B and H in the Data Point Reader. If you want to zoom in the graph, click on the graph by left mouse button and select area to zoom in. If you want to zoom out the graph to default scale, click on

the graph by left mouse button and move the mouse to the left upper corner of the graph. If you click on the graph by right mouse button, you can move in current scale of the graph.

3.1.2. Zoom Function

To be able to view the hysteresis loop of the ferrites more closely, the program provides a zoom function (only valid for power materials in this version).

Zoom in - Click into the area of the graph with the left mouse button.

Zoom out - Click into the area of the graph with the right mouse button.

3.2. Initial Permeability

For all available EPCOS ferrite materials, the initial permeability as a function of the temperature T can be displayed. For every point of the graph, a pair of values T , μ_i can be displayed. It is possible to display multiple curves in one graph. This provides an optimal material comparison.

3.2.1. Procedure

- Click on the *Material Form* button in the main window. The *Material data* window will be opened.
- Select *μ_i vs. T* .
- Select the desired material.

The initial permeability as a function of the temperature will be displayed.

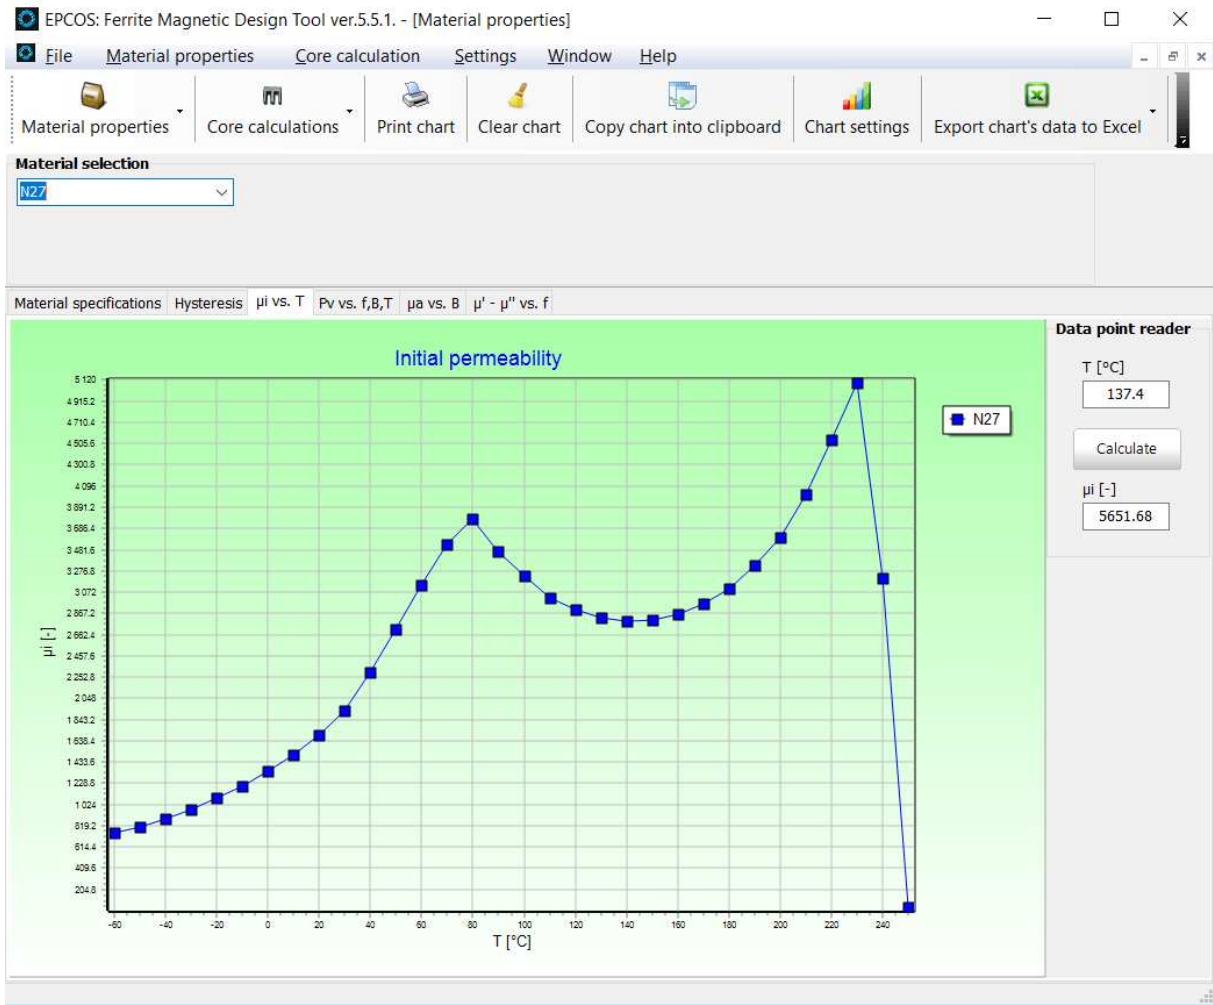


Fig. 3.2 - Initial permeability

- Click on measuring points in the curve to view the value μ_i for a specific temperature in the *DataPoint Reader*.

3.2.2. Intermediate Values of μ_i

It is also possible to calculate intermediate values of μ_i relating to the measuring points (linear interpolation).

- Enter the temperature T [°C] in the input field and click the yellow “calculate” button. The value calculated for the selected material will be displayed in the μ_i output field.

3.3. Power Loss

For all available EPCOS power materials, the power loss per volume and per mass can be represented as a function of the temperature T , the frequency f and the flux density B . The number of measurement data available in the program exceeds the number of data specified in the data book by far. It is possible to display multiple curves in one graph. This provides an optimum material comparison.

3.3.1. Procedure

- Click on the *Material Form* button in the main window. The *Material data* window will be opened.
- Select P_v vs. f, B, T .
- Select the desired material.
- Define the parameters that are to be presented on the X- and Y-axes.
- Select the frequency f , the flux density B or the temperature T (depending on the setting of the X-axis).

Depending on the setting, the power loss will be displayed as a function of T , f or B .

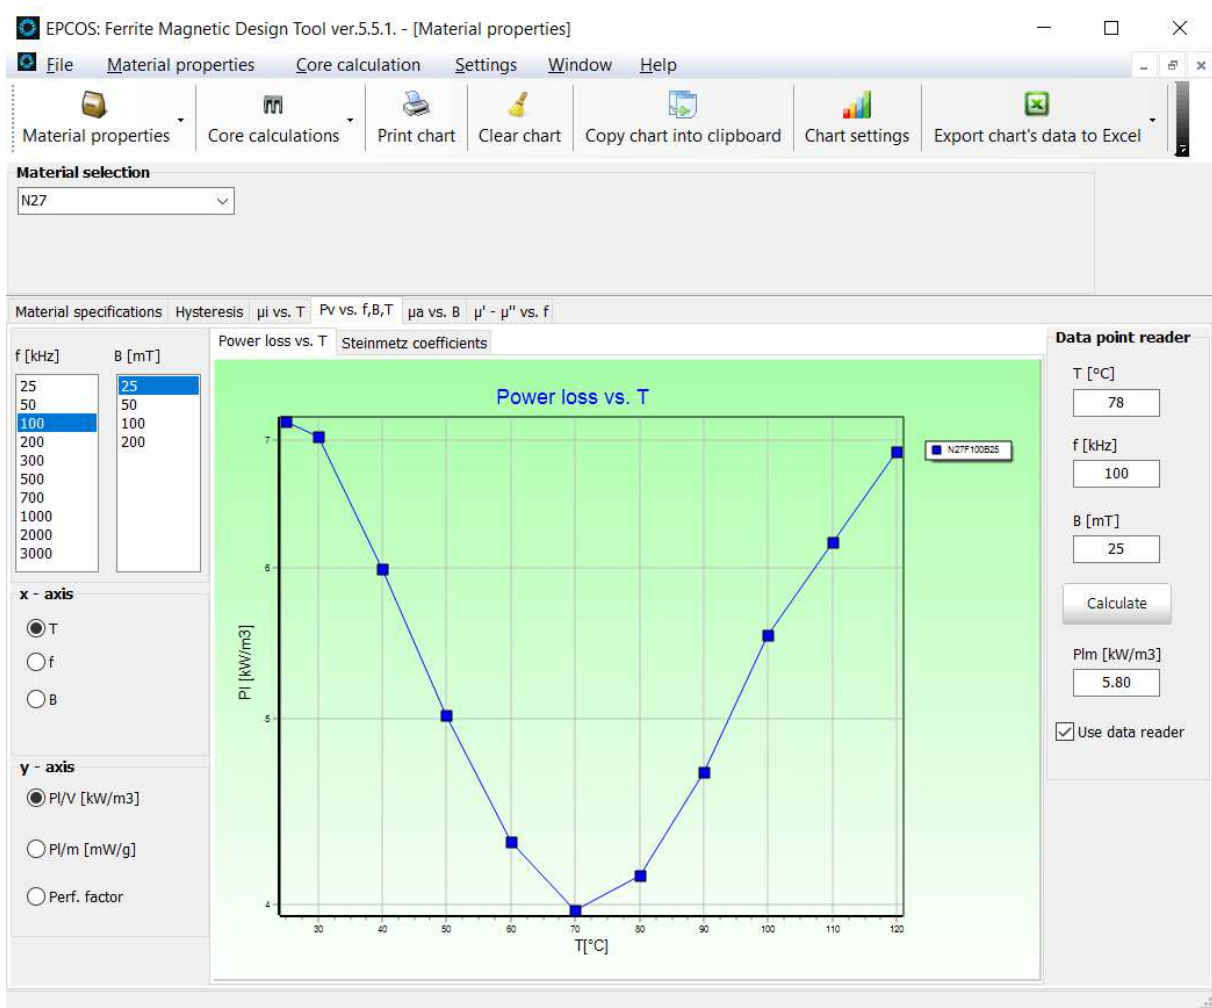


Fig. 3.3 - Power loss vs. T

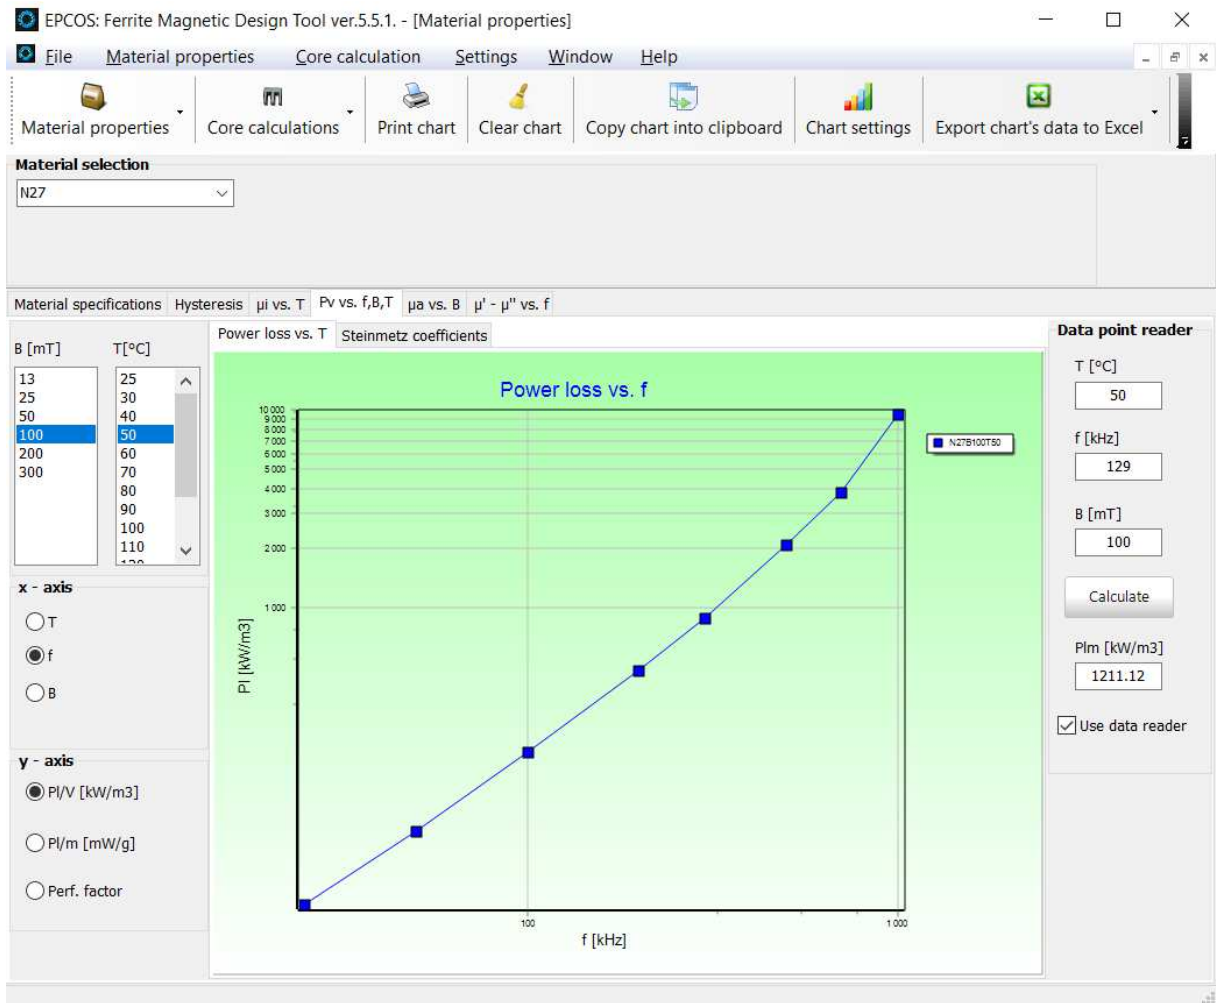


Fig. 3.4 - Power loss vs. f

- Click on measuring points to view the associated pair of values in the *Data Point Reader*.

3.3.2. Measured values of PL

The measured power losses for appropriate combinations of temperature, frequency and flux density can also be displayed.

- Enter the temperature T [°C], the frequency f [kHz] and the flux density B [mT] in the input fields.

The measured values for the selected material will be displayed in the PL output field.

3.3.3. Amplitude Permeability

For all available EPCOS power materials, the amplitude permeability as a function of the flux density B or the field strength H can be represented at the temperatures of $T = 25\text{ °C}$ and $T = 100\text{ °C}$. For every point of the graph, a pair of values B, μ_a or H, μ_a can be displayed. It is possible to display multiple curves in one graph. This provides an optimum material comparison.

3.3.4. Procedure

- Click on the *Material Form* button in the main window. The *Material data* window will be opened.
- Select **μ_a vs. B**.
- Select the desired material.
- Select the desired temperature.
- Select the measurand (B, H) that is to be represented on the X-axis.

The amplitude permeability as a function of the flux density B or of the field strength H will be displayed.

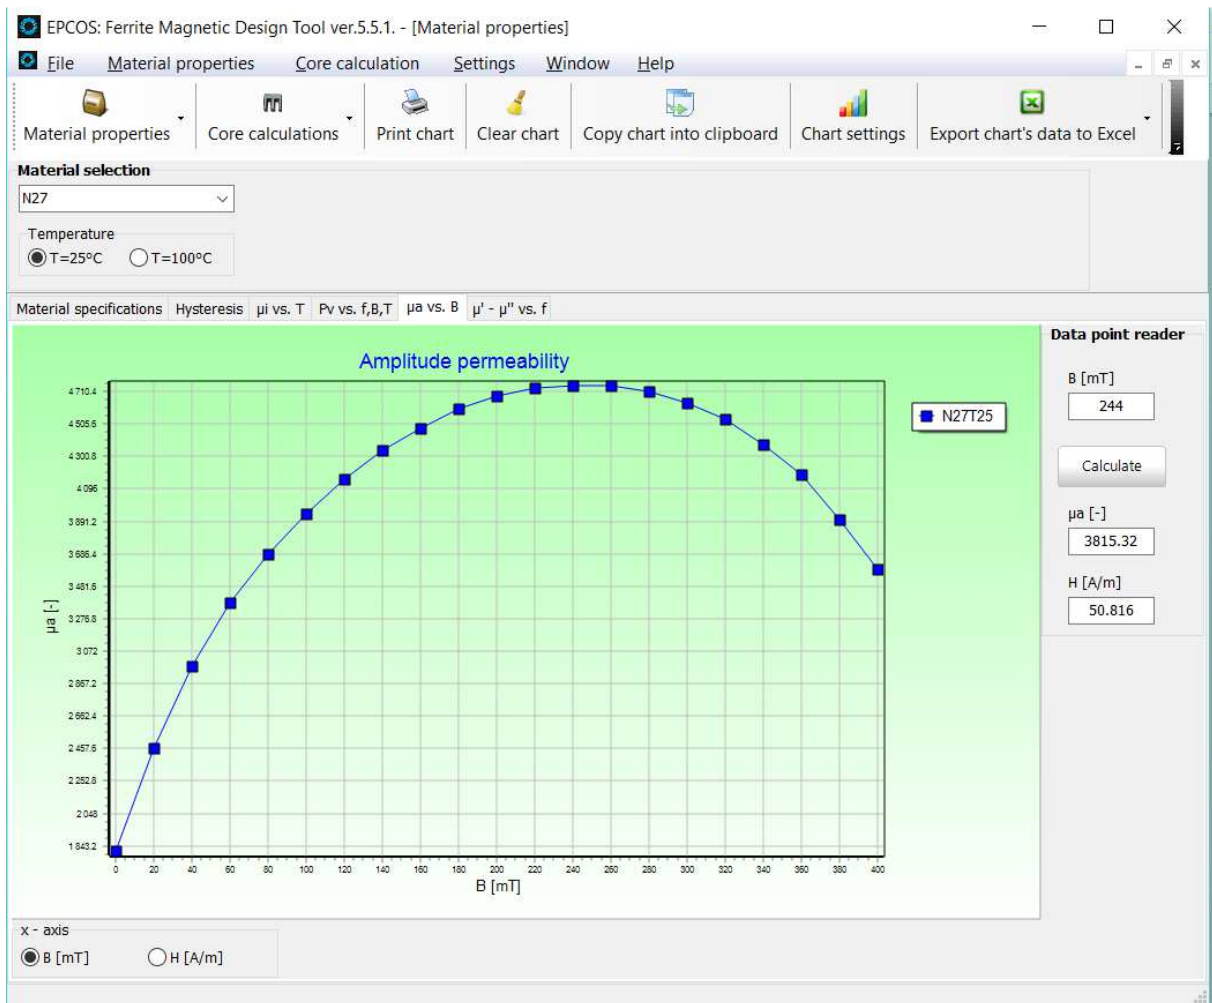


Fig. 3.5 - Amplitude permeability

- Click on a measuring point in the curve to view the associated pair of values B, μ_a or H, μ_a in the Data Point Reader.

3.3.5. Intermediate values of μ_a

It is also possible to calculate intermediate values of μ_a relating to the measuring points. The measurand you can enter depends on the setting for the X-axis.

- Enter the desired value in the input field (H or B) and click the yellow “calculate” button.

The value calculated for the selected material will be displayed in the μ_a output field.

3.4. Complex Permeability

For all available EPCOS materials, the complex permeability can be represented as a function of the frequency. You can select one of seven display types $\mu_s'(f)$, $\mu_s''(f)$, $\mu_p'(f)$, $\mu_p''(f)$, $g_p(f)$, $\tan\delta/\mu_i(f)$ or $Z_N(f)$. It is possible to display multiple curves in one graph. The different parameters provide an optimum material comparison for various applications:

- the relative loss factor $\tan\delta/\mu$ for filter inductors with high Q
- the parallel conductance $g_p(f)$, which is directly proportional to the insertion loss, for broadband transformers
- the normalized impedance $Z_N(f)$ for EMI suppressors

The relationship among the different parameters is given as follows:

$$\mu_p'^2(f) = \frac{\mu_s'^2(f) + \mu_s''^2(f)}{\mu_s'^2(f)}$$

$$\mu_p''^2(f) = \frac{\mu_s'^2(f) + \mu_s''^2(f)}{\mu_s''^2(f)}$$

$$\frac{\tan\delta(f)}{\mu_i} = \frac{1}{\mu_i} \cdot \frac{\mu_s'(f)}{\mu_s''(f)}$$

$$g_p(f) = \frac{1}{f \cdot \mu_p''(f)}$$

$$Z_N(f) = 2 \cdot \pi \cdot f \cdot \mu_0 \sqrt{\mu_s'^2 + \mu_s''^2}$$

3.4.1. Procedure

- Click on the *Material Form* button in the main window. The *Material data* window will be opened.
- Select **$\mu'-\mu''$ vs. f** .
- Select the desired material.
- Select whether $\mu_s'(f)$, $\mu_s''(f)$, $\mu_p'(f)$, $\mu_p''(f)$, $g_p(f)$, $\tan\delta/\mu_i(f)$ or $Z_N(f)$ are to be represented.

The graph will be displayed.

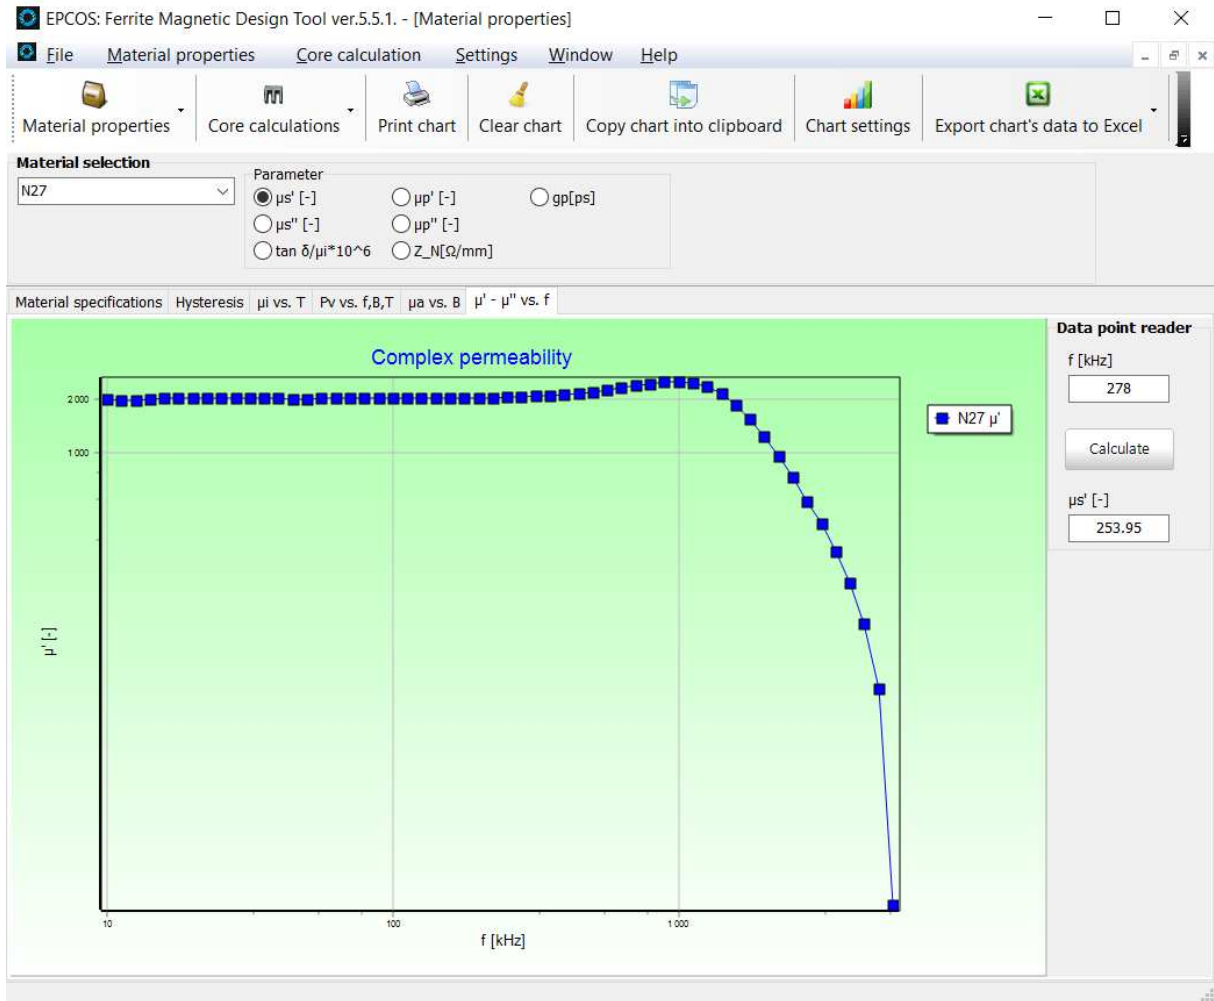


Fig. 3.6 - Complex permeability

- Click on measuring points in the curve to view the associated pairs of values in the Data Point Reader.

3.4.2. Intermediate values of $\mu_s' (f)$, $\mu_s'' (f)$, $\mu_p' (f)$, $\mu_p'' (f)$, $gp(f)$, $\tan\delta/\mu_i (f)$ or $Z_N(f)$

- Enter the desired frequency in the input field and click the yellow "calculate" button. $\mu' (f)$, $\mu'' (f)$ and $\tan\delta/\mu_i$ will be displayed.

4. Core Form

4.1. Effective Permeability

For all available EPCOS materials, the core-form-specific $\mu_e(T)$ characteristics based on the $\mu_i(T)$ material curve (measured on ring cores) can be calculated. This calculation is performed according to the well-known equation:

$$\frac{1}{\mu_e} = \frac{1}{\mu_i} + \frac{s}{le}$$

It is possible to display multiple curves in one graph. This provides an optimum comparison (e.g. change of the air gap).

4.1.1. Procedure

- Click on the *Core Form* button in the main window. The *Core data* window will be opened.
- Select **μ_e vs. T** .
- Select the desired core.
- Specify the core form (optionally: low profile, with hole). *Note:* Please observe that not all combinations are valid (e.g. in low profile, only RM cores are available). Values will not be output if an invalid combination was specified.
- Select the desired material.
- Select the type of representation $\mu_e(T)$ or $(\mu_e(T) - \mu_e(T1))/(\mu_e(T))$.
- Enter the desired air gap in the s field.

The effective permeability as a function of the temperature will be displayed.

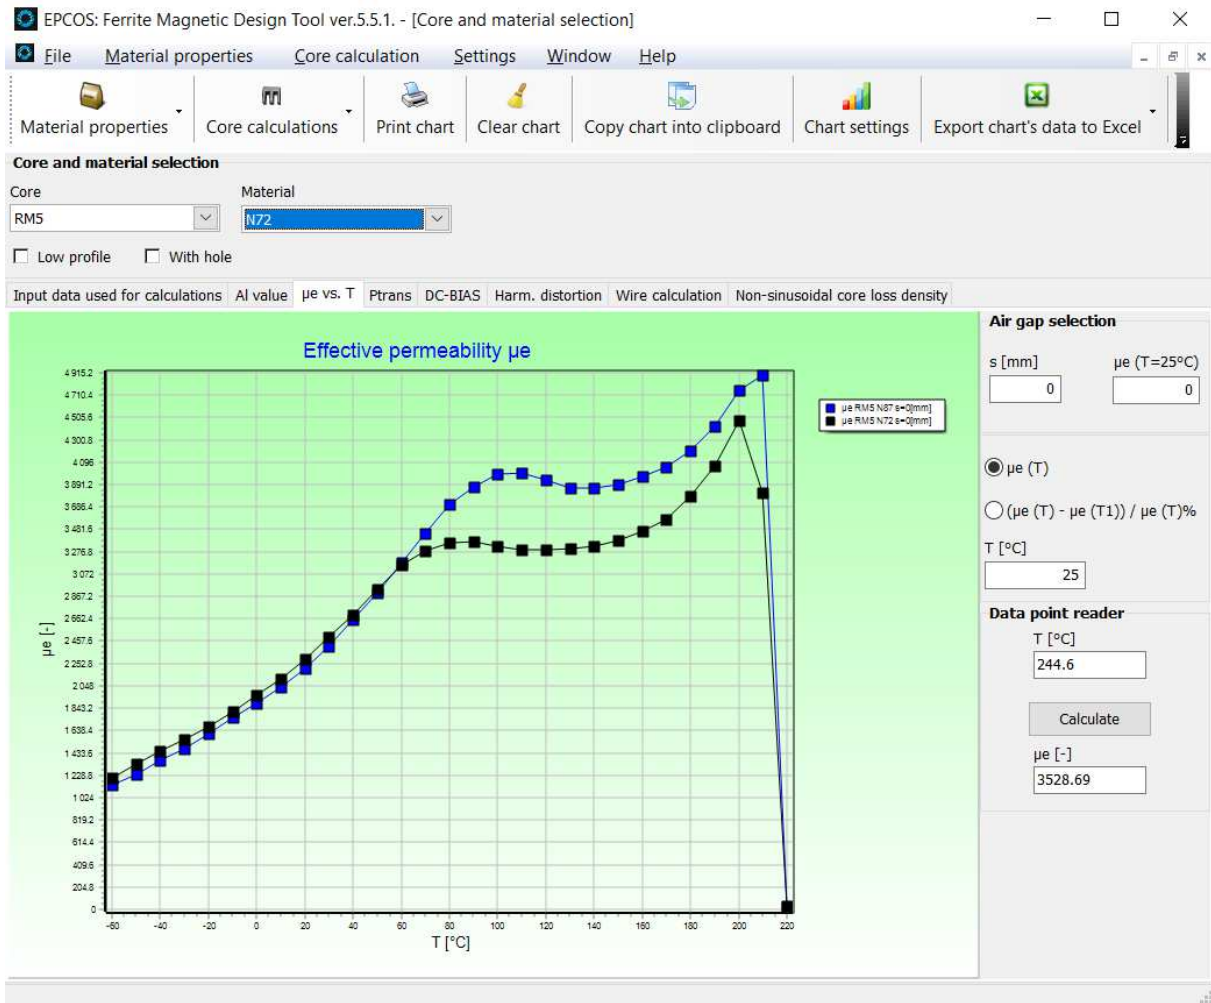


Fig. 4.1 - Comparison of the effective permeability using different air gaps.

- Click on points in the curve to view the associated pairs of values T , μ_e in the *Data Point Reader*.

4.2. Transferable Power P_{trans}

For all power materials and most cores, the transferable power P_{trans} can be determined.

4.2.1. Procedure

- Click on the *Core Form* button in the main window. The *Core data* window will be opened.
- Select P_{trans} .
- Select the desired core.
- Specify the core form (optionally: low profile, with hole). *Note:* Please observe that not all combinations are valid (e.g. in low profile, only RM cores are available). Values will not be output if an invalid combination was specified.
- Select the desired material.
- Correct for the default thermal resistance R_{th} value (fre-air convection), if a better figure is known for your application.

- Enter the desired values in the $dTCu$, $dTFe$ and f input fields.
- Correct for the default copper space factor $fCu=0.4$ if a better figure is known for your application.
- If a wire calculation on the selected core type has been performed previously, click the “get Rac/Rdc ” button to consider proximity and skin effects in the $Ptrans$ calculation.
- Select the appropriate converter type in the pull down menu.
- $Ptrans$ will be displayed in the output field after pressing the yellow “calculate” button.

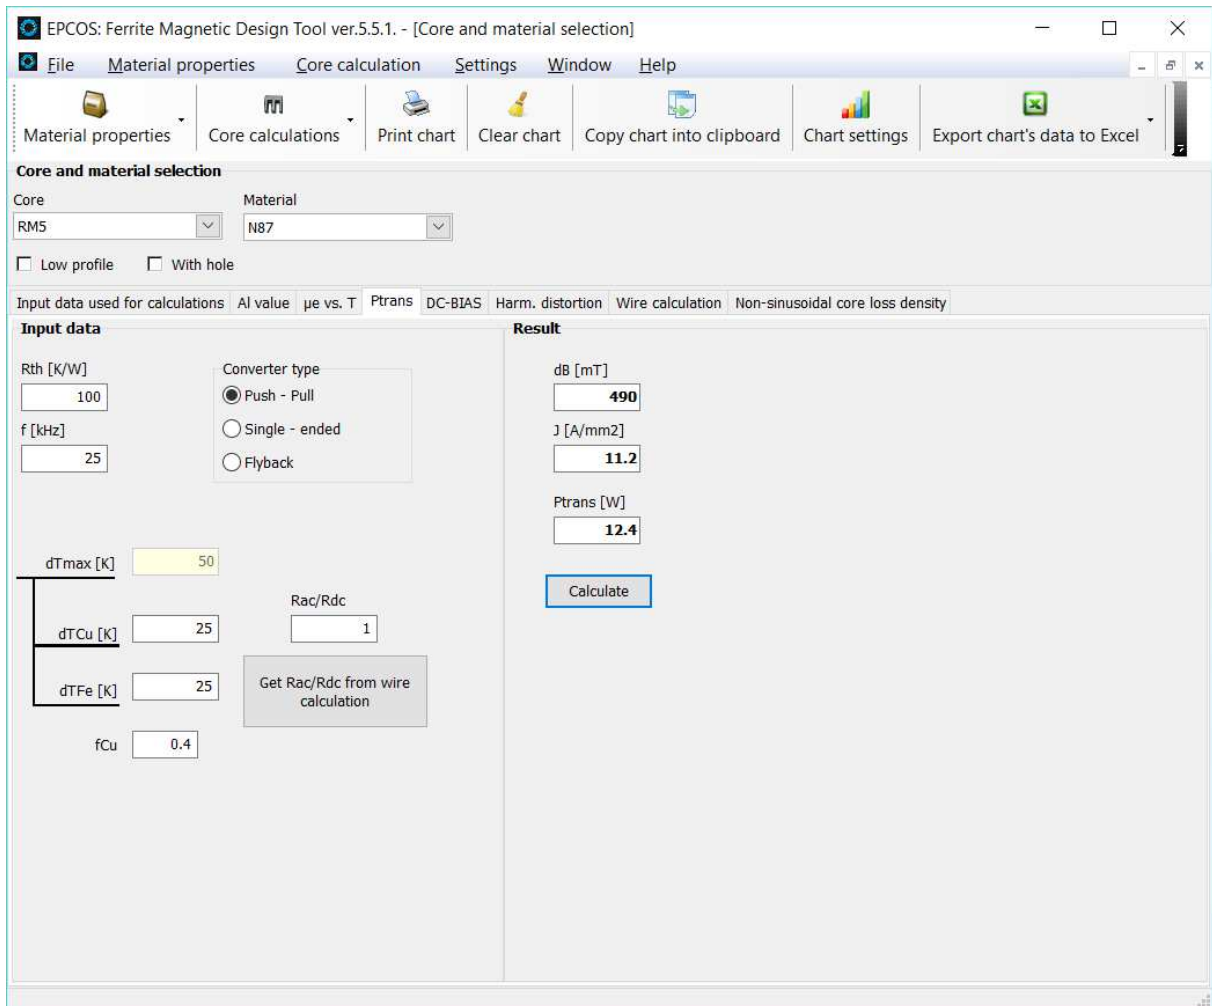


Fig. 4.2 - Transferable power Trans

4.2.2. Further Description of the Input Fields

- fCu : copper space factor
 $dTCu$: copper temperature rise [K]
 $dTFe$: ferrite temperature rise [K]

The transferable power $Ptrans$ of transformers can be calculated by the following approximation:

$$(1) \quad P = C \cdot f \cdot \Delta B \cdot S \cdot f_{cu} \cdot A_N \cdot A_e$$

The constant C relates to the operation mode which is:

- C=1 in push-pull converters
- C=0,71 in single-ended converters
- C=0,62 in flyback converters 1) .

Further quantities in equation (1) are the switching frequency f, the sweep of flux density ΔB , the current density S, the winding cross section A_N and the effective area A_e .

4.3. Data Overview

For all EPCOS materials and core shapes, various digital data are represented in the form of a table.

4.3.1. Procedure

- Click on the *Core Form* button in the main window.

The *Core data* window will be opened. Select **Data overview**.

The screenshot shows the 'EPCOS: Ferrite Magnetic Design Tool ver.5.5.1. - [Core and material selection]' window. The 'Core and material selection' section shows 'Core: RM5' and 'Material: N87'. The 'Core parameters - default data' section shows: Ae [mm2] = 23.8, le [mm] = 22.1, Ve [mm3] = 526, Amin [mm2] = 18, An [mm2] = 9.5, Ln [mm] = 25. The 'User's defined data' section contains a table with the following data:

Core's name	Ae [mm2]	le [mm]	Amin [mm2]	An [mm2]	Ln [mm]	K1	K2	CDF	Coil's height
ELP16_EPCOS_KA	42.561	31.996	40.835	0	0	0	0	0	0
ELP16_TDG	42.149	31.696	41.25	0	0	0	0	0	0
ER47	237.4	79.7	235.1	98.6	92.43	0	0	0	14.73

The 'Core's assembling' section shows 'Core's count for assembling "n": 1' and a 'Create user data from selected core' button. A note explains that the count 'n' affects core parameters: 1. Result Ae = n * Ae; 2. Result Amin = n * Amin. A 3D model of a core is shown on the right.

Fig. 4.3 - Data overview

- Select the desired core.
- Specify the core form (optionally: low profile, with hole). *Note:* Please note that not all combinations are valid (e.g. in low profile, only RM cores are available). Values will not be output if an invalid combination was specified.
- Select the desired material.

4.4. AL-values

For all available EPCOS materials, the following calculations can be performed using the calculator:

- AL as a function of the air gap and vice-versa without taking into account the fringe flux
- AL as a function of the air gap and vice-versa using the K-factors (only for EE-, EC-, ER, ETD-, EFD-, EPF-, and ELP-cores in N27, N67, N87)
- The inductance as a function of the AL value and vice-versa

4.4.1. Procedure

- Click on the *Core Form* button in the main window. The *Core data* window will be opened.
- Select **AL-value**

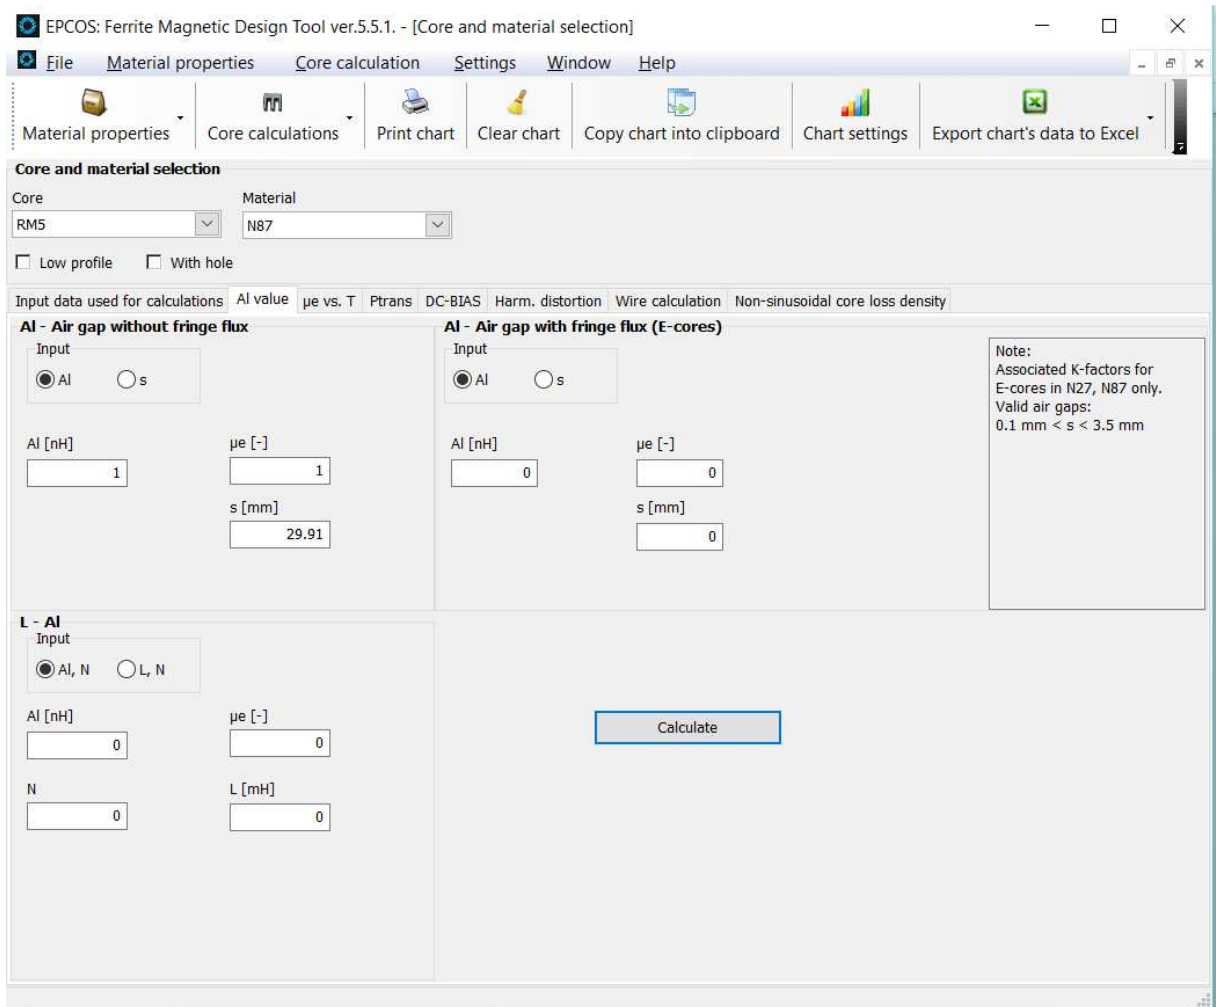


Fig. 4.4 - AL-value

- Select the desired core.
- Specify the core form (optionally: low profile, with hole). *Note:* Please observe that not all combinations are valid (e.g. in low profile, only RM cores are available). Values will not be output if an invalid combination was specified.
- Select the desired material.
- Enter the values for the calculation in the input fields and click the yellow “calculate” button.

The results will be displayed in the associated output fields.

4.5. DC-Bias

For all available EPCOS power materials and most core shapes, the reversible permeability can be calculated as a function of the DC-current as well as of the DC-field with a given AI value. For this purpose, the temperatures $T = 25\text{ }^{\circ}\text{C}$ and $T = 100\text{ }^{\circ}\text{C}$ are taken into consideration. With a given number of turns, the reversible inductance and the magnetic energy can additionally be calculated.

4.5.1. Procedure

- Click on the *DC-Bias* button in the main window. The *DC-Bias* window will be opened.

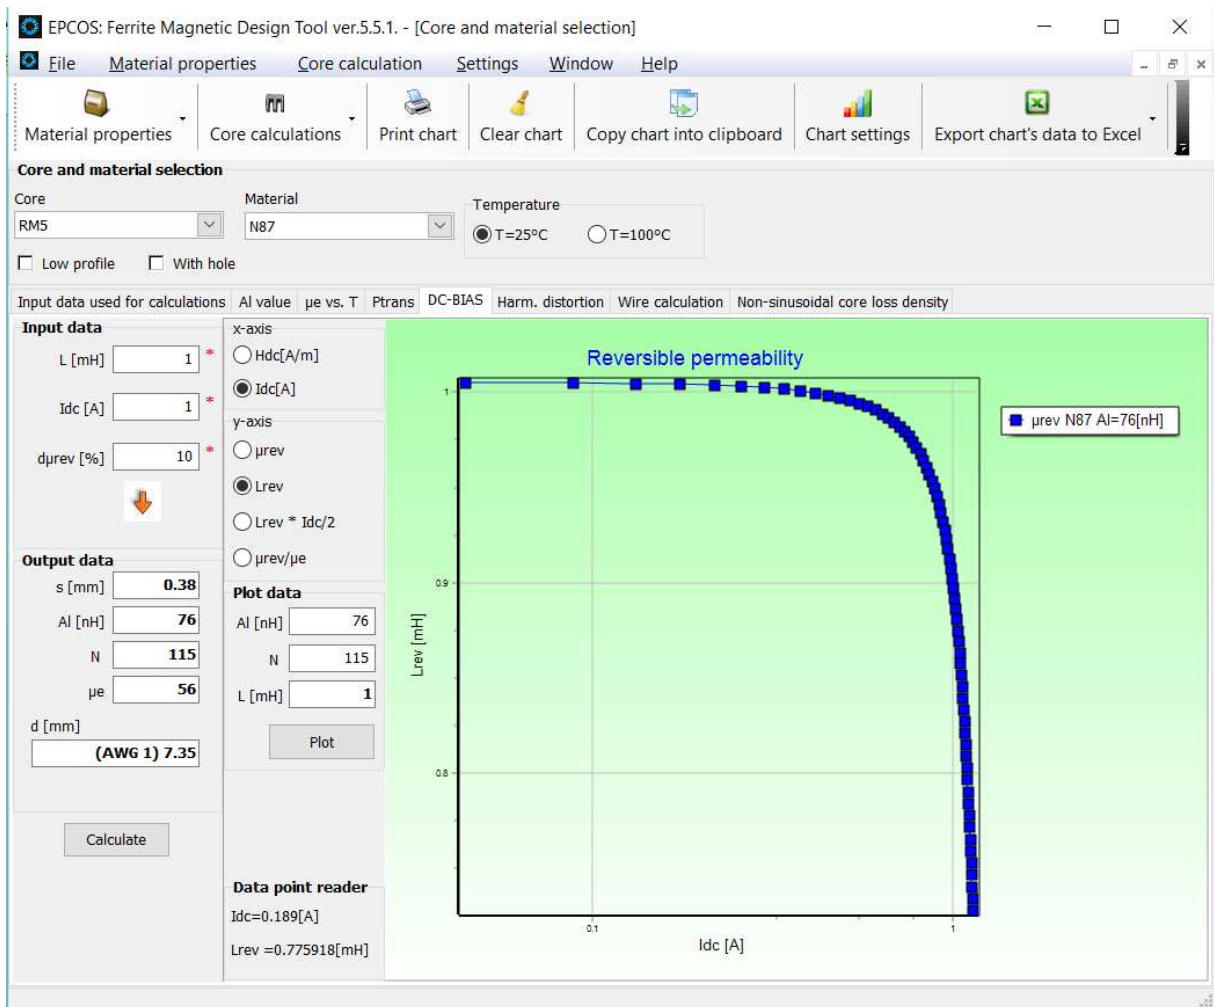


Fig. 4.5 - DC-Bias

- Select the desired core.
- Specify the core form (optionally: low profile, with hole). *Note:* Please observe that not all combinations are valid (e.g. in low profile, only RM cores are available). Values will not be output if an invalid combination was specified.
- Select the desired material.
- Select the desired temperature (T = 25 °C or T = 100 °C).
- Select the measurands that are to be represented on the X- and Y-axes.
- Enter the desired values for the unbiased inductance L in [mH], the DC-current I_{dc} in [A] and the roll-off p in[%] in the corresponding input fields.
- Click the yellow “calculate” button. The calculated values will be displayed in the output fields and a corresponding plot shown.
- If you want to change the AI value and/or number of turns N for new plot data, enter the new values and press the *Return* key.

The new resulting unbiased inductance and the graph will be displayed.

4.5.2. Underlying Formulae 1) :

$$\frac{\mu_{\text{rev}}}{\mu_i} = 3 \cdot \frac{df(x)}{dx}, \quad \frac{B}{B_s} = \coth x - \frac{1}{x} = f(x)$$

$$\frac{1}{\mu_e} = \frac{1}{\mu_i} + \frac{s}{le}$$

$$B = \mu_a(B) \cdot \mu_0 \cdot H$$

- Click on measurement points in the curve to view the associated measured values in the *DataPoint Reader*.

4.6. Third Harmonic Distortion

For a given core and a given material, the calculated ratio of the AC-to DC-resistance vs. Frequency for sinusoidal current waveforms can be displayed.

4.6.1. Procedure

- Click on the *Harmonic Distortion* button in the main window.

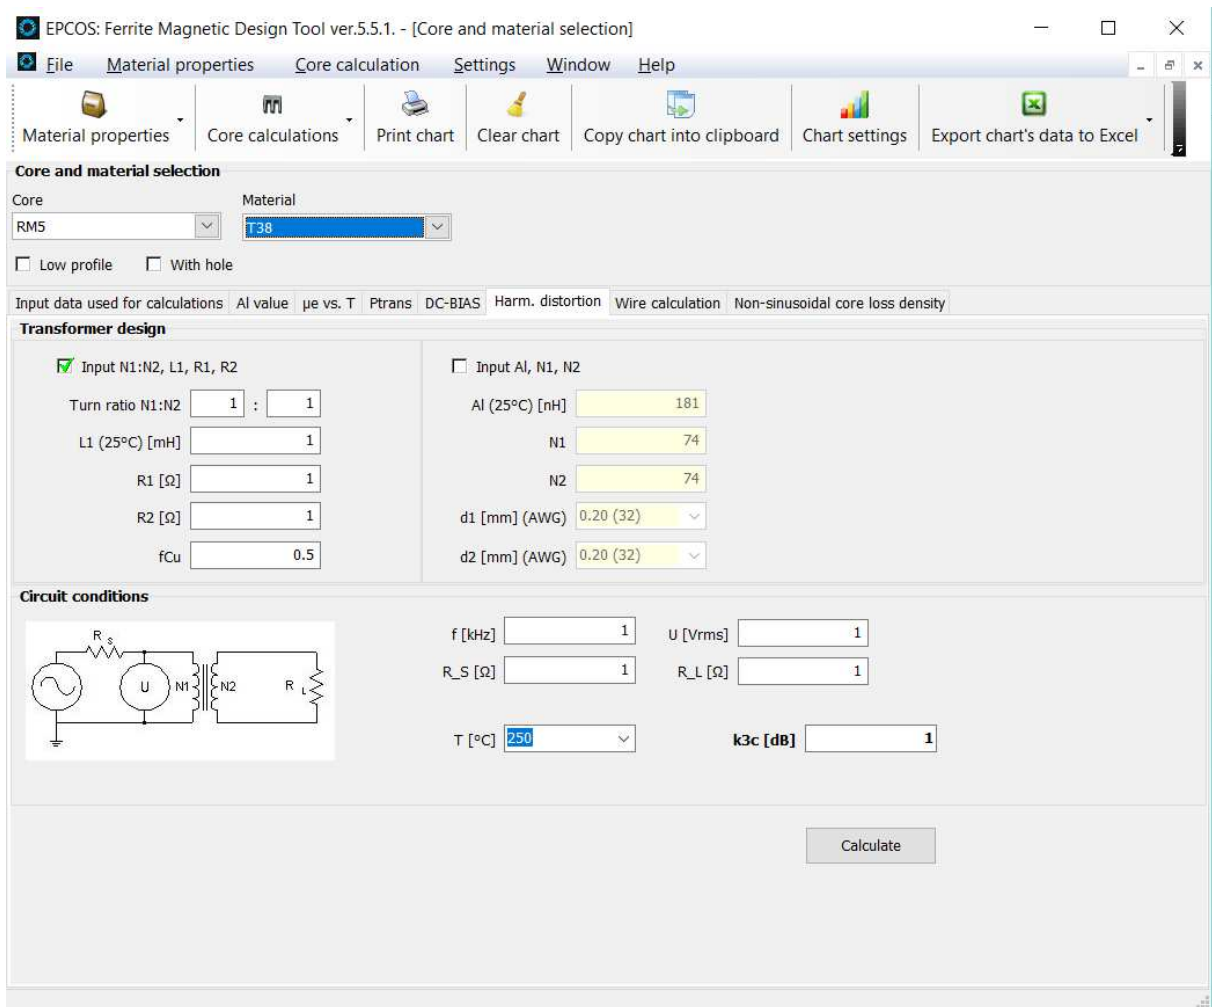


Fig. 4.6 - Third harmonic distortion

- Select the desired core.
- Specify the core form (optionally: low profile, with hole). *Note:* Please observe that not all combinations are valid (e.g. in low profile, only RM cores are available). Values will not be output if an invalid combination was specified.
- Select the desired material.
- Select the desired input option: turns ratio/inductance/resistances or AL-value/number of turns/wire diameter
- Enter the desired values in the corresponding input fields. The calculated values will be displayed in the output fields.

4.6.2. Underlying Formulae:

By using the following equations the third harmonic distortion k_3 for the voltage based on Rayleigh's hysteresis model can be calculated. The in-circuit distortion k_{3c} follows from consideration of the impedance conditions.1) ...

$$k_3 = \frac{0.6}{\mu_0} \cdot \underbrace{\eta_B}_{\text{material}} \cdot \underbrace{\frac{\hat{U}}{\omega}}_{\text{circuit conditions}} \cdot \underbrace{L_k \left[\frac{\rho}{f_{Cu}} \sum_{k=1} \left(\frac{N_k}{N_1} \right)^2 \frac{1}{R_k} \right]^{3/2}}_{\text{design constraints}} \cdot \underbrace{\frac{\sum I_i}{I_e} \cdot \frac{l_e}{A_e^2} \cdot \frac{l_N^{3/2}}{A_N^{3/2}}}_{\text{geometry}}$$

$$k_{3c} = \frac{k_3}{\sqrt{1 + \left[3\omega L_1 \cdot \left(\frac{1}{R_S} + \left(\frac{N_2}{N_1} \right)^2 \cdot \frac{1}{R_L} \right) \right]^2}}$$

4.7. Wire Design

For a given core and a given material, the calculated ratio of the AC-to DC-resistance vs. Frequency for sinusoidal current waveforms can be displayed.

4.7.1. Procedure

- Click on the *Wire Calculation* button in the main window.

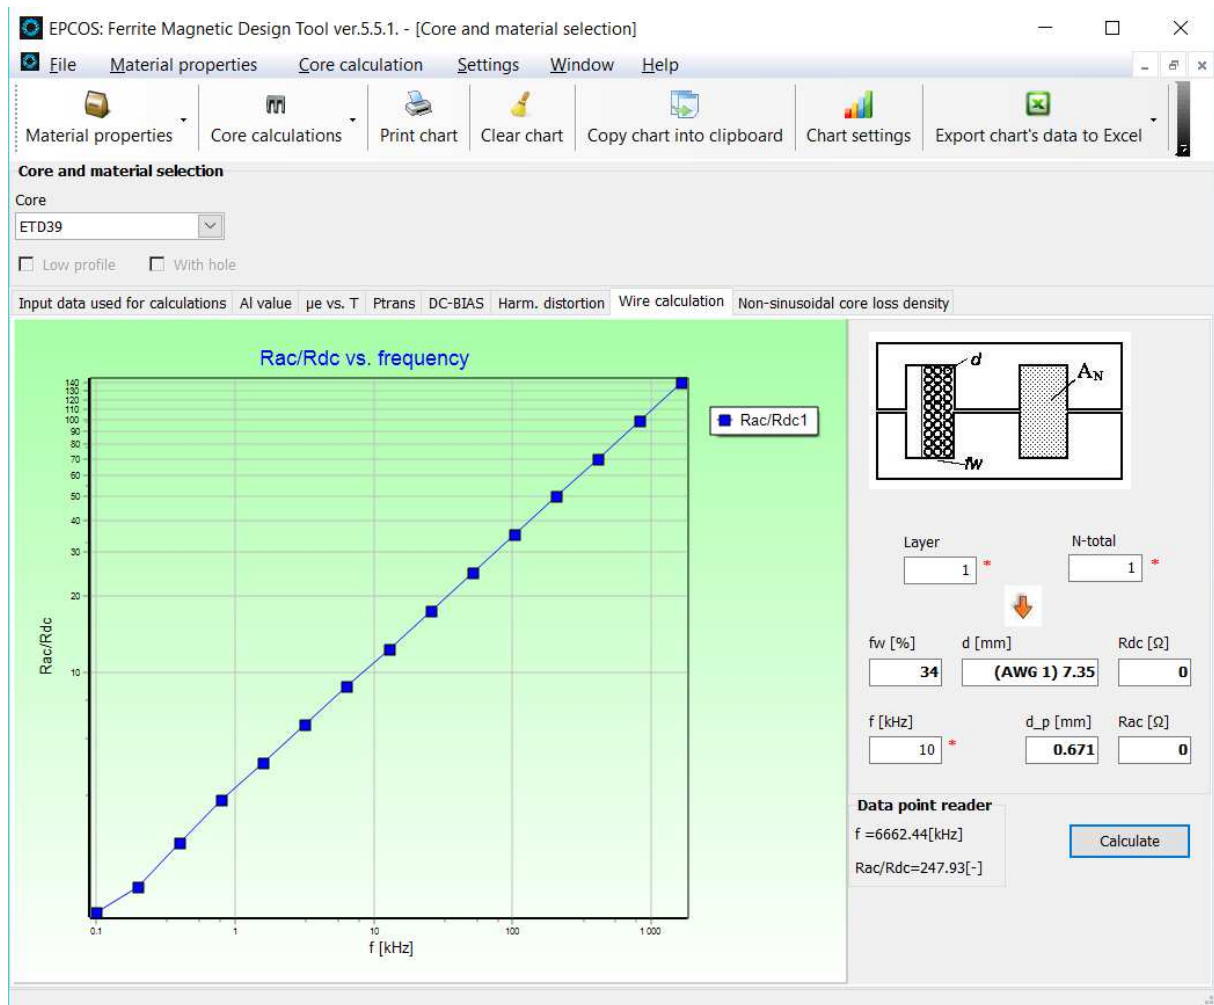


Fig. 4.7 - Wire design

- Select the desired core.
- Specify the core form (optionally: low profile, with hole). *Note:* Please observe that not all combinations are valid (e.g. in low profile, only RM cores are available). Values will not be output if an invalid combination was specified.
- Select the total number of turns
- Select the number of layers
- Click the yellow “calculate” button
- The graph will be displayed. If the window fill factor fw surpasses 100% a warning message will be shown.

4.7.2. Underlying Formulae:

By using the following equations the winding copper losses for sinusoidal current can be estimated. 1) \cdot x stands for the ratio of the wire diameter to the frequency-dependent penetration depth, m stands for number of layers.

$$M = x \frac{\sinh(2x) + \sin(2x)}{\cosh(2x) - \cos(2x)} ,$$

$$D = 2x \frac{\sinh(x) - \sin(x)}{\cosh(x) + \cos(x)} ,$$

$$F_r = M + \frac{m^2 - 1}{3} D ,$$

$$\frac{R_{ac}}{R_{dc}} = F_r$$

5. Graph Control

5.1. Introduction

In the „Edit Chart“ form you can print graphs, insert graphs in other Windows applications via the Clipboard and define the representation of the graph.

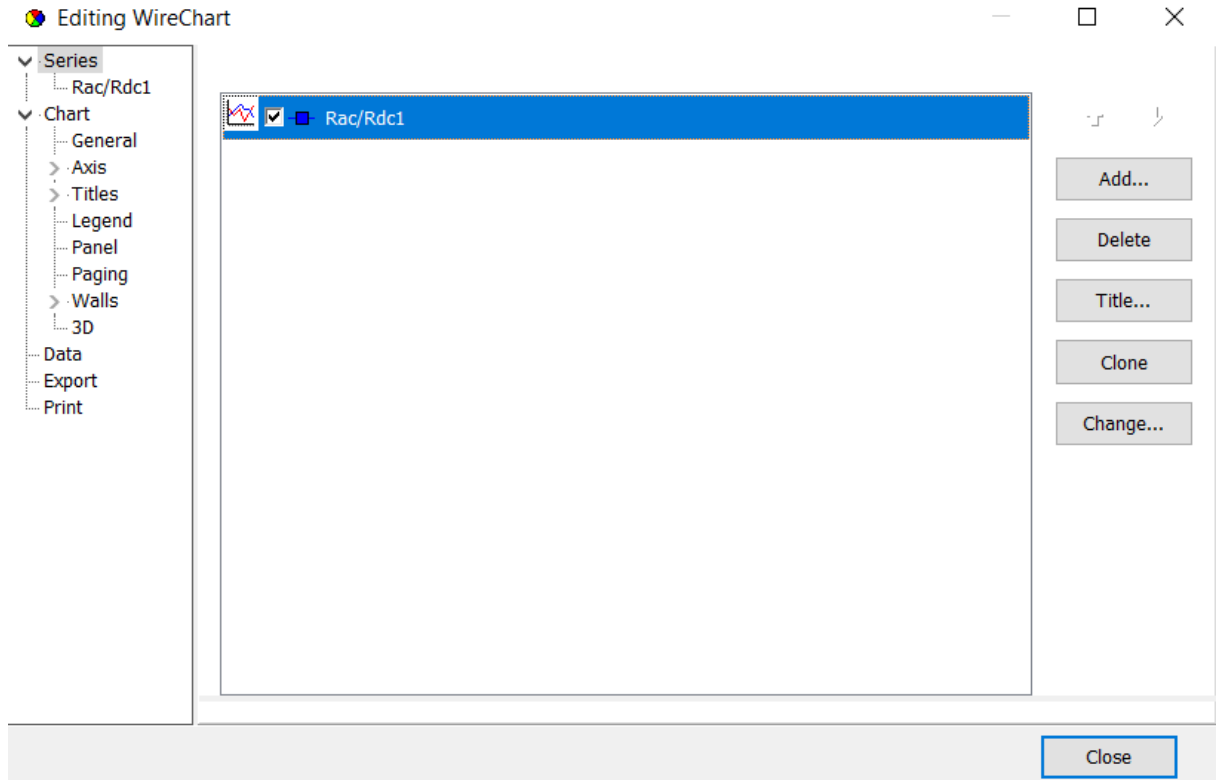


Fig. 5.1 – Edit chart form

5.2. Graph Layout

In the windows for controlling the graph layout, you can define the appearance of your graph. Among other things, you can set the background color, select the axis representation and the desired value range.

Clicking on „Close“ will close the window.

5.3. Printing a graph

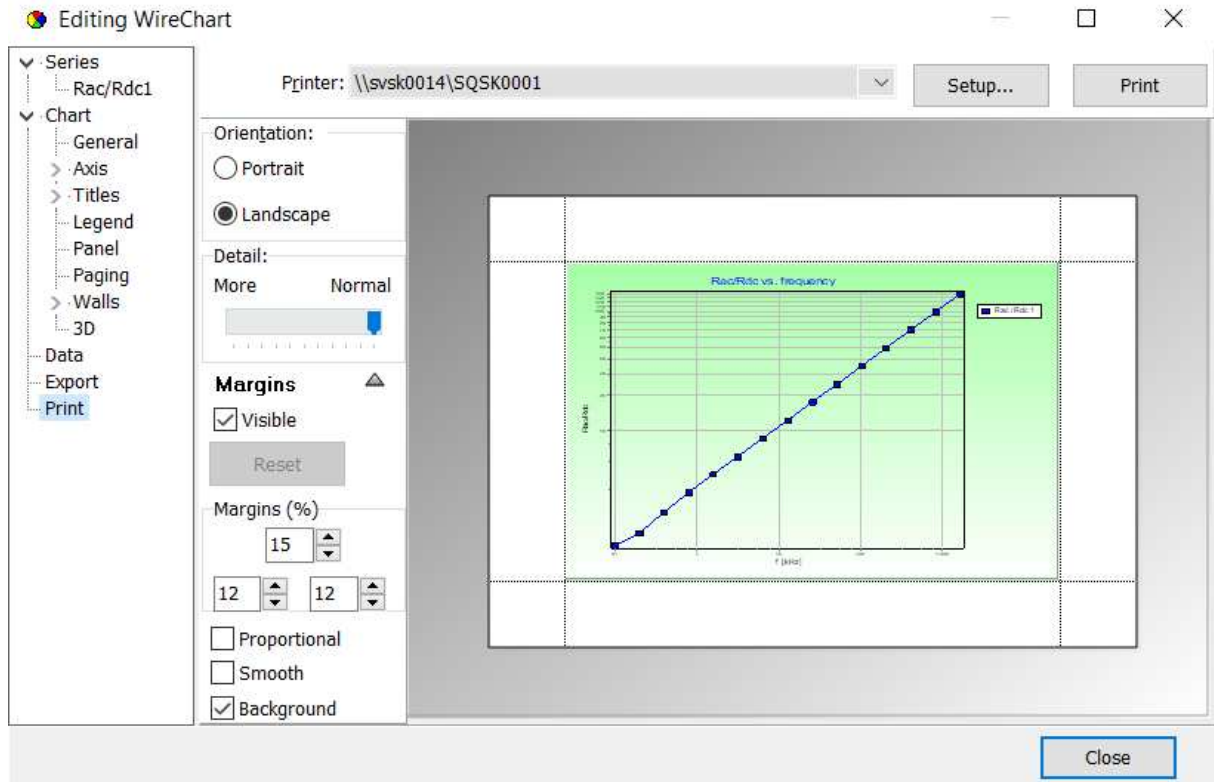


Fig. 5.2 – Printing of graph

- Select printing orientation
- Select printer
- Click on the *Print* button.

The graph will be printed on the selected printer.

5.4. Exporting a graph

You can export the current graph as a graphics file or copy it to the Clipboard to make it available for other Windows applications.

5.4.1. Exporting of graph as file

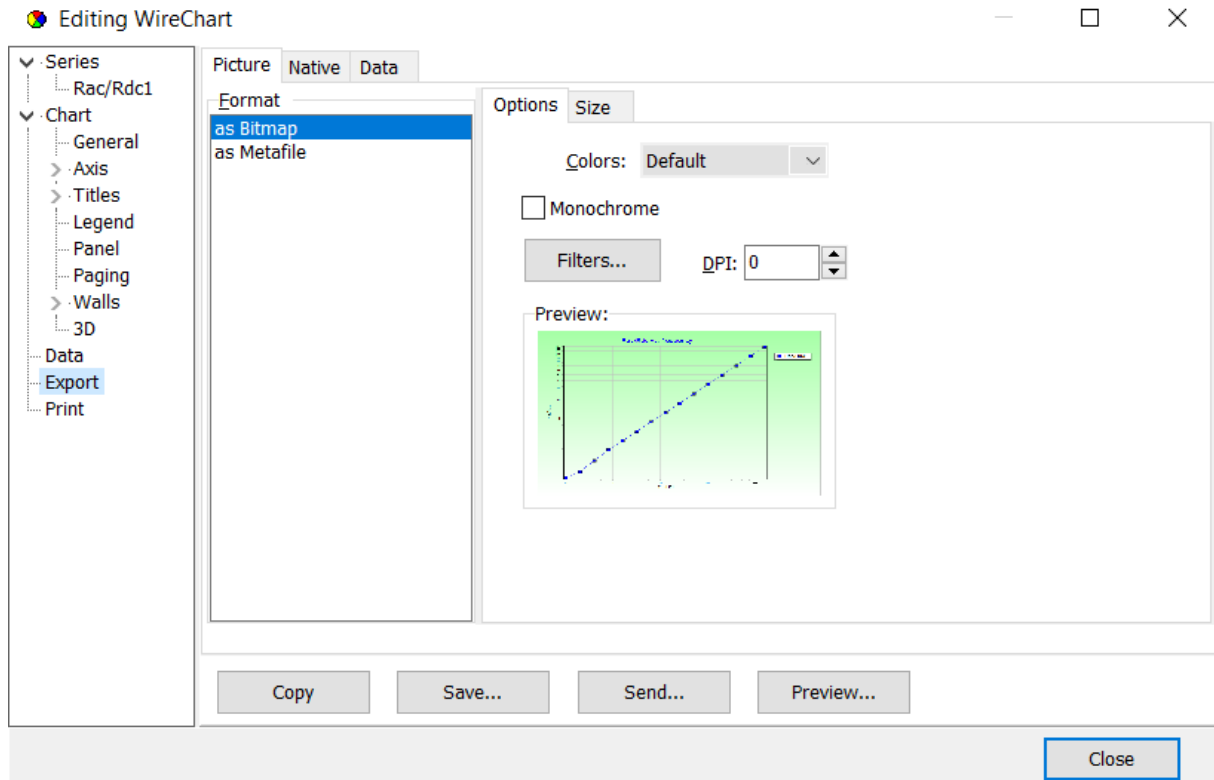


Fig. 5.3 – Graph exporting

- Select the desired data format in the *Export* window area (Metafile or Bitmap).
- Specify the target by button „Save...“
- Click on the „Save“ button.

The graphics file will be saved.

5.4.2. Copying a graph via the clipboard

Proceed as follows to copy the current graph to the Clipboard to make it available for other Windows applications:

- Select the desired data format in the *Export* window area (Metafile or Bitmap).
- Click on the *Copy* button. The graphics file will be saved.
- Now change to your Windows application (e.g. Word). Position the cursor to the desired insertion point and select *Paste*.

The graph will be inserted in your document.

5.4.3. Exporting data into external file

If you want to export data from chart into external file, use following setup (Fig. 17):

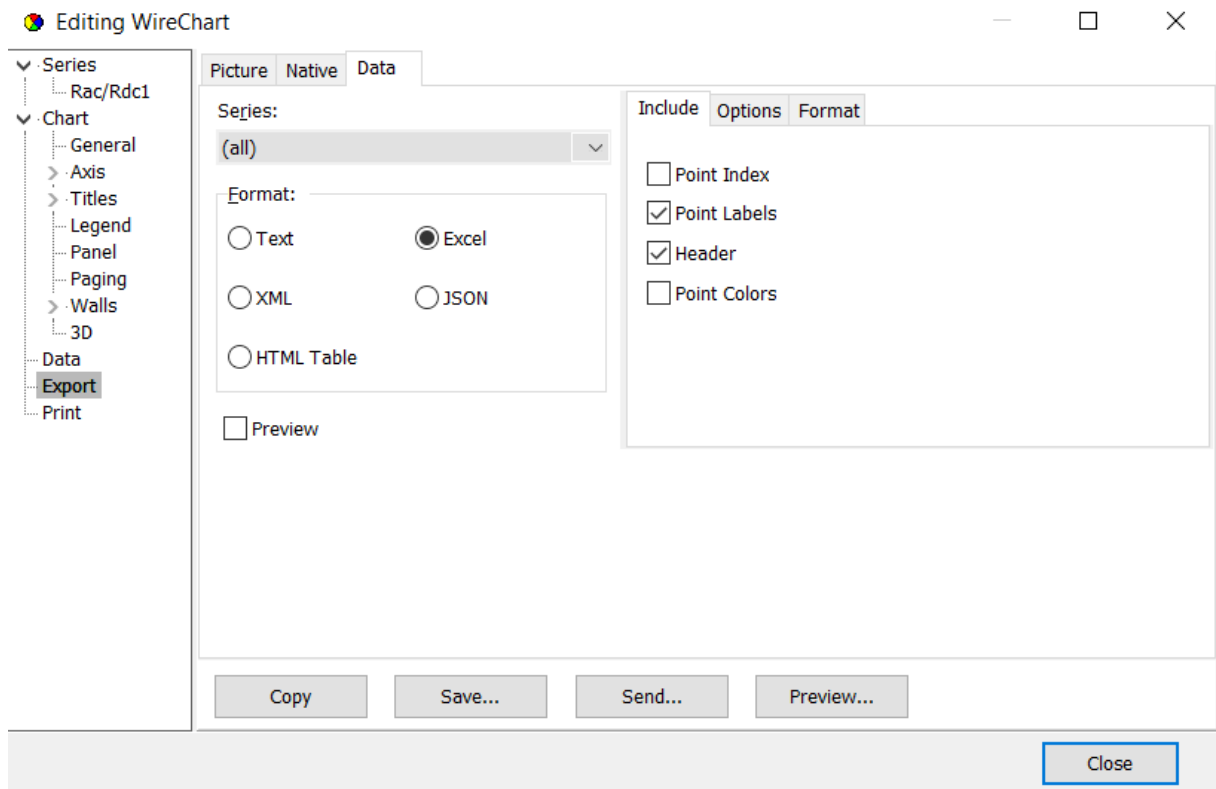


Fig. 17 – Data export

Select desired output format in “Format” group and click on button ‘Save’. Data will be exported into selected file format (it’s MS Excel on Fig.17).

6. Settings

If you want to change a font of visual controls, select “Settings – Options”. Following form will be displayed – Fig.18.

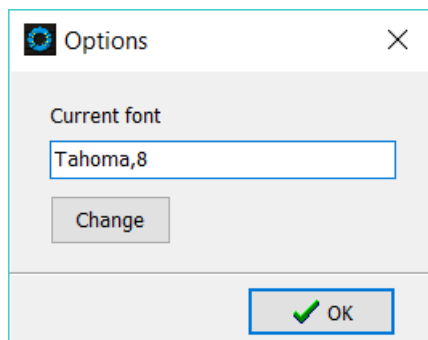


Fig. 18 – Options

Click on button “Change” and select desired font. The font will be saved on hard disk and this font will be used during next running of application.

7. Reference List

- [1] E. C. Snelling [1988], Soft Ferrites, Butterworths, 2nd Edn.
- [2] P. L. Dowell [1966], Effects of eddy currents in transformer windings, Proc. IEE, Vol. 113, No. 8.
- [3] B. Carstens [1995], Calculating Skin and proximity effect conductor losses in switch mode magnetics, PCIM'95 seminar notes.
- [4] T. Werner, J. Hess [1996], Core loss measurements in high frequency power materials-measurement methods for the frequency range up to 10 MHz, Proceedings of the PCIM'96, pg. 611-622.
- [5] R. Gaus [1911], Die Gleichung der Kurve der reversiblen Suszeptibilität, Phys. Z. 12, pp 1053 - 1054
- [6] W. Kampczyk, E. Röß [1978], Ferritkerne, Siemens AG
- [7] G. Roespel [1978], Effect of the magnetic material on the shape and dimensions of transformers and chokes in switched-mode power supplies, Siemens AG München, J. of Magn. and Magn. Materials 9, pp 145 - 149
- [8] M. Esguerra [1997] , "Ferrite Core Design for Broadband Design of Telecom Transformers", MMPA User's Conference, Chicago.
- 8] H. Meuche, M. Esguerra [1999] , "Ferrite Cores for xDSL: Optimum Selection"EMCW'99, Cincinatti.